



City of Pomona — Building and Safety Division

Patio Cover Standard

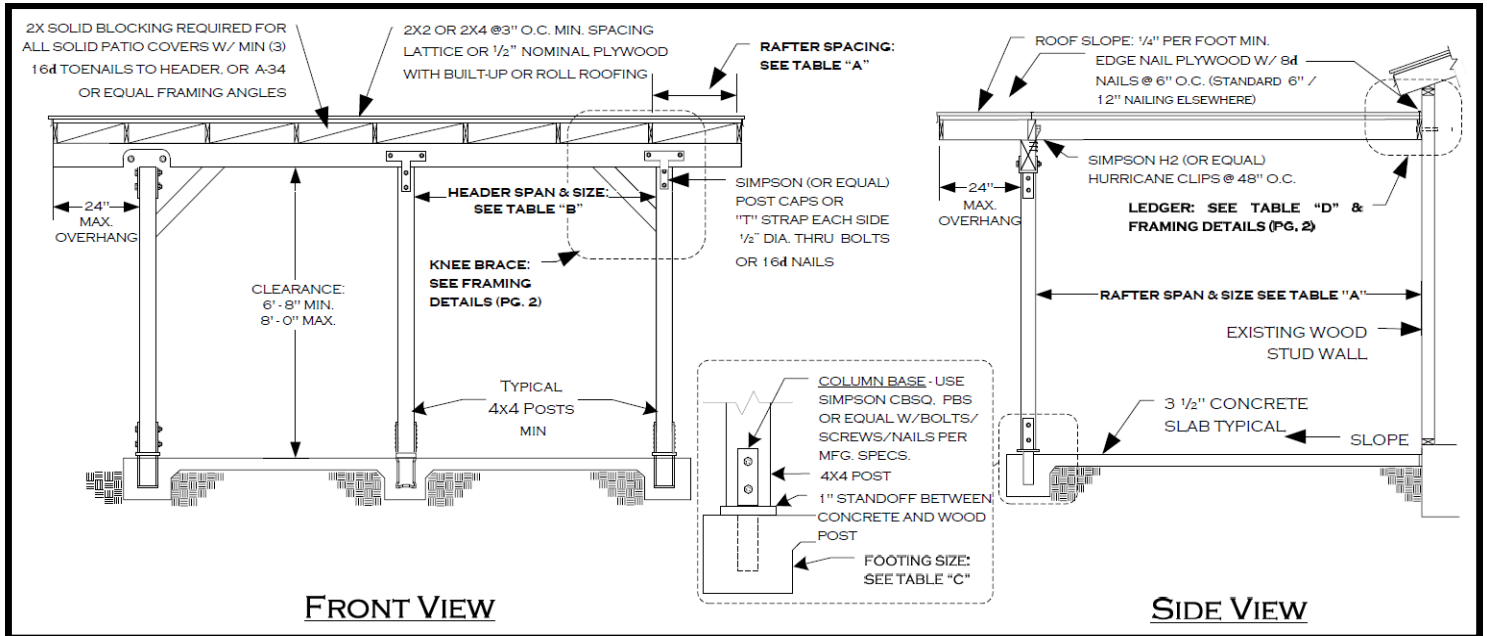


TABLE "A" RAFTER SPANS (DOUGLAS FIRE #2 OR BETTER)		
SIZE	SPACING	SPAN
2 X 4	12" O.C.	9'-10'
	16" O.C.	8'-11'
	24" O.C.	7'-10'
2 X 6	12" O.C.	15'-6"
	16" O.C.	14'-1"
	24" O.C.	11'-11"
2 X 8	12" O.C.	20'-5"
	16" O.C.	18'-5"
	24" O.C.	15'-1"
2 X 10	12" O.C.	26'-0"
	16" O.C.	22'-6"
	24" O.C.	18'-6"
2 X 12	12" O.C.	26'-0"
	16" O.C.	26'-0"
	24" O.C.	21'-4"

TABLE "B" HEADER SIZE & SPANS (DOUGLAS FIRE #2 OR BETTER)		
RAFTER SPAN	HEADER	
	SPAN	SIZE
UP TO 12'-0"	8'-0" MAX	4 X 6
	10'-0" MAX	4 X 8
	12'-0" MAX	4 X 10
12'-1" TO 20'-0"	14'-0" MAX	4 X 12
	8'-0" MAX	4 X 8
	10'-0" MAX	4 X 10
12'-1" TO 20'-0"	12'-0" MAX	4 X 12
	14'-0" MAX	4 X 14





TABLE "C" FOOTING SIZE
BASED ON 1000 P.S.F. SOIL BEARING PRESSURE.
18" SQ. x 12" DEEP
18" SQ. x 12" DEEP
18" SQ. x 12" DEEP
18" SQ. x 12" DEEP
24" SQ. x 12" DEEP
24" SQ. x 12" DEEP
24" SQ. x 12" DEEP
24" SQ. x 12" DEEP

TABLE "D" LEDGER BOLTING
ALL LAG BOLTS SHALL HAVE 1/4" PRE-DRILLED HOLES
1/2" DIA, X 5" LONG AT 16" O.C. STAGGERED.
(2) 3/8" DIA X 5" LONG AT 16" O.C.

NOTES:

- Two 2x members may be substituted for one 4x horizontal framing member.
- Lag bolts must fully engage a wood stud or rim joist and be provided with appropriate washers. Lag bolts shall be located a minimum of 1-1/2" from the top or bottom of the ledger.
- Not designed to be enclosed - Additional engineering analysis will be required if enclosed.
- See page 2 of 2 for construction details.
- Artificial lighting is required in rooms that have window openings into the covered patio area if the total window area in that room is less than 10% or the floor area of the room or 20 square feet, whichever is greater.
- Concrete mix for footings shall have a minimum compressive strength of 2500 psi @ 28 days.

DISCLAIMER: Alternate patio designs may be possible when provided with an engineered analysis. Use of this conventional standard design is at the user's risk and carries no implied or inferred guarantee against failure or defects.

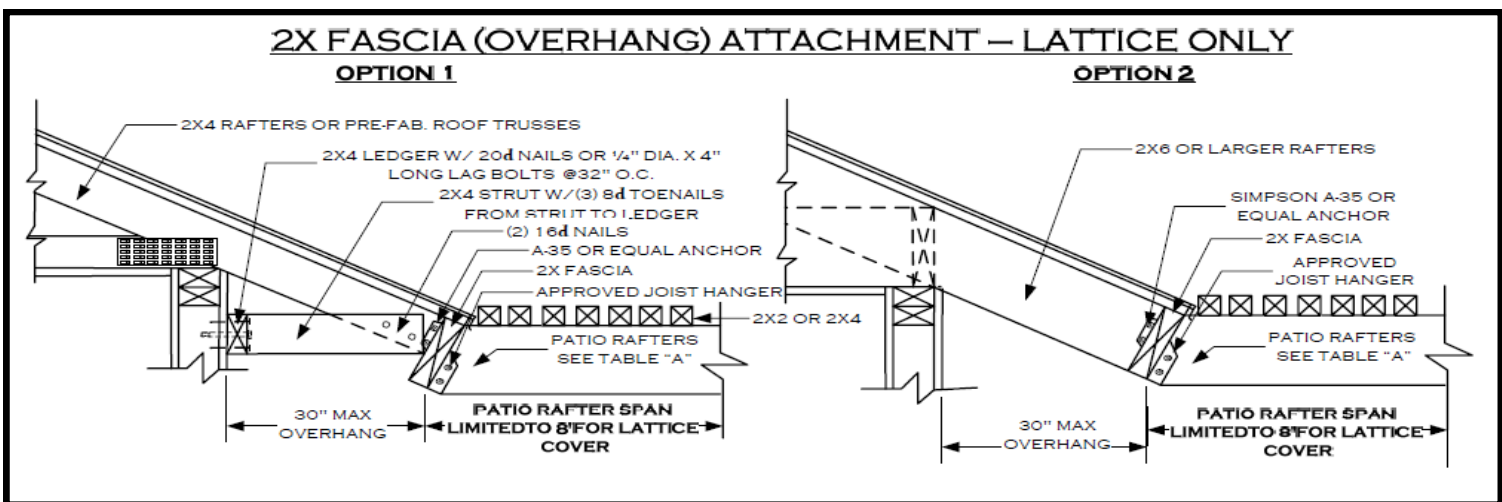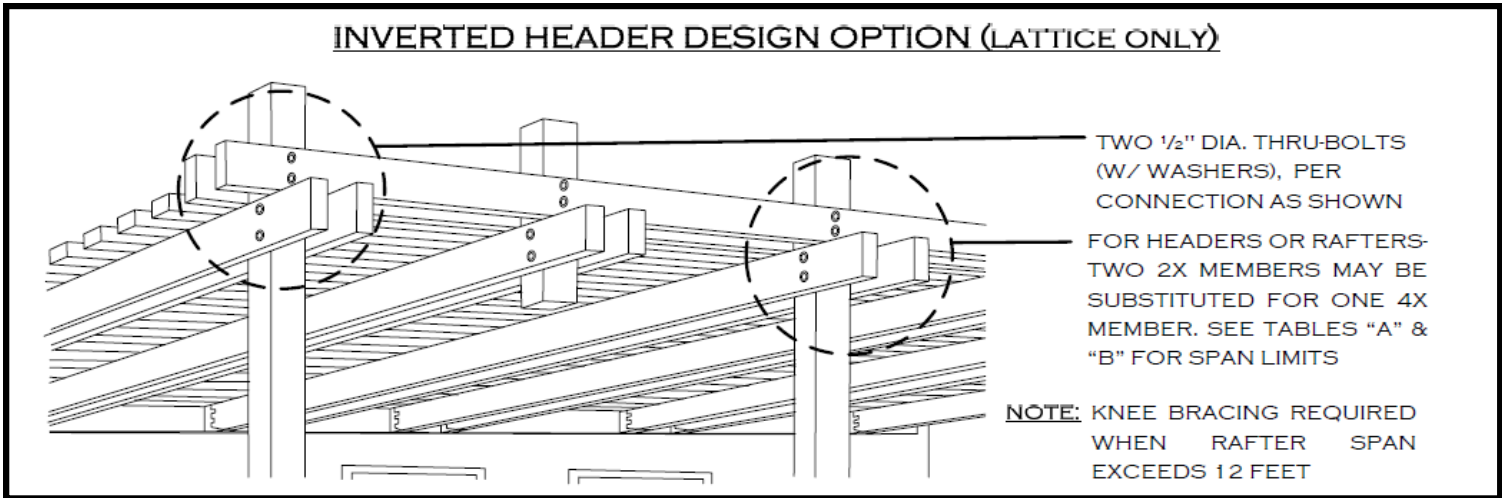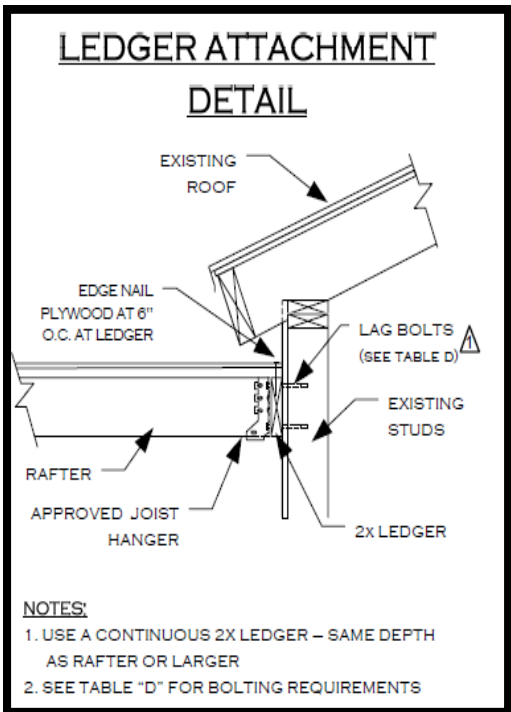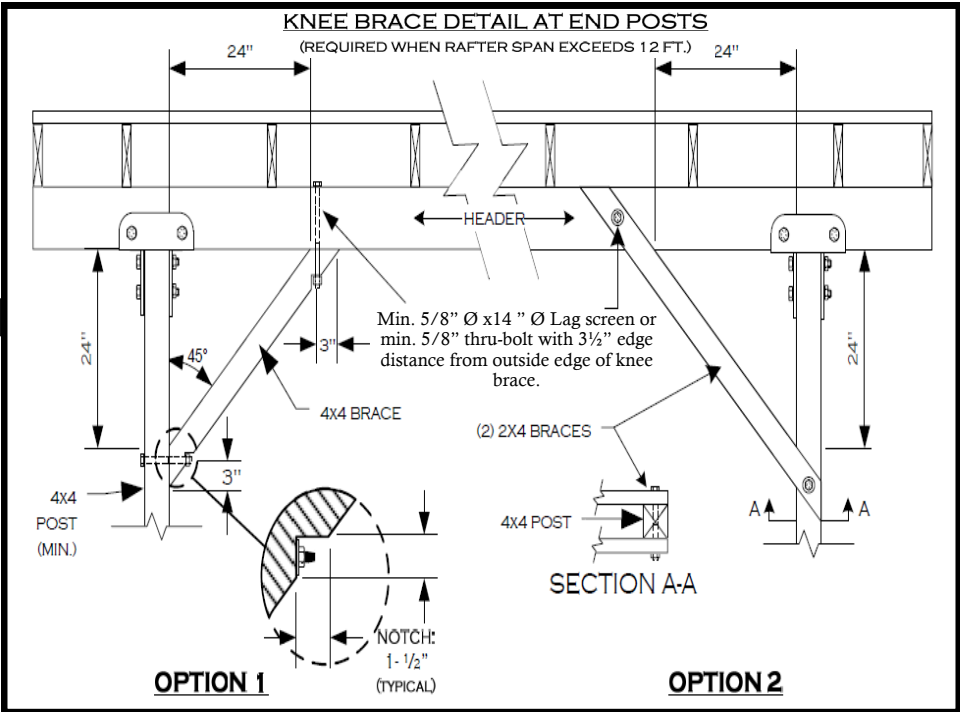

NOTE:

Verify structural soundness of roof rafters for decay or termite damage, and replace with like materials as needed, after consultation with the Building Department.